

**Shinbo**

# Indoor Sensors

DSW

Temperature

Humidity

Temperature  
and Humidity

CO<sub>2</sub> Concentration




## ■ Sensor Type

| Measurement Target   | Measurement Range                                 | Output                                | Lead Wire Color    | Model               | Power Supply    |
|----------------------|---------------------------------------------------|---------------------------------------|--------------------|---------------------|-----------------|
| Temperature          | 0 to 50°C                                         | 100Ω/ 0°C (Pt100) 3-wire type         | RED, WHT, WHT      | DSW-100-TR          | No power supply |
|                      |                                                   | 4 to 20 mA DC (2-wires)               | RED, WHT           | DSW-100-TA          | 24 V DC ± 10%   |
|                      |                                                   | 4 to 20 mA DC (4-wires)               | RED, WHT, BRW, BLK | DSW-100-TA W4       |                 |
| Humidity             | 5 to 90 %RH                                       | 4 to 20 mA DC (2-wires)               | ORG, YLW           | DSW-100-H           | 24 V DC ± 10%   |
|                      |                                                   | 4 to 20 mA DC (4-wires)               | ORG, YLW, BRW, BLK | DSW-100-H W4        |                 |
|                      |                                                   | 0 to 1 V DC (4-wires)                 | ORG, YLW, BRW, BLK | DSW-100-HV W4       |                 |
| Temperature Humidity | 0 to 50°C<br>5 to 90 %RH                          | Temp: 100 Ω / 0°C (Pt100) 3-wire type | RED, WHT, WHT      | DSW-100-TRHV W4     | 24 V DC ± 10%   |
|                      |                                                   | Humi: 0 to 1 V DC (4-wires)           | ORG, YLW, BRW, BLK |                     |                 |
|                      |                                                   | Temp: 4 to 20 mA DC (2-wires)         | RED, WHT           | DSW-100-TAH         |                 |
|                      |                                                   | Humi: 4 to 20 mA DC (2-wires)         | ORG, YLW           |                     |                 |
|                      |                                                   | Temp: 4 to 20 mA DC (2-wires)         | RED, WHT           | DSW-100-TAH W4      |                 |
|                      |                                                   | Humi: 4 to 20 mA DC (4-wires)         | ORG, YLW, BRW, BLK |                     |                 |
| CO <sub>2</sub>      | 360 to 2000 ppm (with Sensor Correction Function) | Temp: 4 to 20 mA DC (2-wires)         | RED, WHT           | DSW-100-TAHV W4     | 24 V DC ± 10%   |
|                      |                                                   | Humi: 0 to 1 V DC (4-wires)           | ORG, YLW, BRW, BLK |                     |                 |
|                      |                                                   | 4 to 20 mA DC                         | RED, WHT, BRW, BLK | DSW-200-CO2-11□ (*) |                 |
|                      |                                                   | 0 to 20 mA DC                         | RED, WHT, BRW, BLK | DSW-200-CO2-12□ (*) |                 |
|                      |                                                   | 1 to 5 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-13□ (*) |                 |
|                      |                                                   | 0 to 5 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-14□ (*) |                 |
|                      | 360 to 5000 ppm (with Sensor Correction Function) | 0 to 1 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-15□ (*) |                 |
|                      |                                                   | 4 to 20 mA DC                         | RED, WHT, BRW, BLK | DSW-200-CO2-21□ (*) |                 |
|                      |                                                   | 0 to 20 mA DC                         | RED, WHT, BRW, BLK | DSW-200-CO2-22□ (*) |                 |
|                      |                                                   | 1 to 5 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-23□ (*) |                 |
|                      |                                                   | 0 to 5 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-24□ (*) |                 |
|                      |                                                   | 0 to 1 V DC                           | RED, WHT, BRW, BLK | DSW-200-CO2-25□ (*) |                 |

(\*) 0: Moisture-proof treatment unavailable, 1: Moisture-proof treatment available.

(Abbreviations: Temp: Temperature, Humi: Humidity)

## ■ Specifications
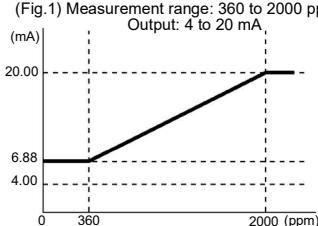
|                                                                                                                                                                                                                                                                                     |                                                                                                                                                           |                                                                                                                                                                                                                                                                                                         |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Output                                                                                                                                                                                                                                                                              | Temperature                                                                                                                                               | 100 Ω / 0°C (Pt100) 3-wire type<br>4 to 20 mA DC (Linear conversion corresponding to 0 to 50°C) Maximum allowable load: 500 Ω max.                                                                                                                                                                      |
|                                                                                                                                                                                                                                                                                     | Humidity                                                                                                                                                  | 4 to 20 mA DC (Linear conversion corresponding to 0 to 100 %RH) Maximum allowable load: 500 Ω max.<br>0 to 1 V DC (Linear conversion corresponding to 0 to 100 %RH) Maximum allowable load: 500 Ω max.                                                                                                  |
|                                                                                                                                                                                                                                                                                     | CO <sub>2</sub>                                                                                                                                           | 4 to 20 mA DC, 0 to 20 mA DC, Maximum allowable load: 550 Ω max.<br>1 to 5 V DC, 0 to 5 V DC, Maximum allowable load: 5 kΩ minimum.<br>0 to 1 V DC, Maximum allowable load: 1 kΩ minimum.                                                                                                               |
| <p><b>&lt;Output of CO<sub>2</sub> Sensor&gt;</b><br/>For each range of CO<sub>2</sub> concentrations, linearly outputs corresponding to CO<sub>2</sub> concentration. However, if the measured value is lower than 360 ppm, the value corresponding to 360 ppm will be output.</p> |                                                                                                                                                           |                                                                                                                                                                                                                                                                                                         |
| <p>(Fig. 1) Measurement range: 360 to 2000 ppm<br/>Output: 4 to 20 mA</p>                                                                                                                       |                                                                                                                                                           |                                                                                                                                                                                                                                                                                                         |
| Power Consumption                                                                                                                                                                                                                                                                   | Temperature, and Humidity                                                                                                                                 | 2-wire type: Approx. 550 mW (4 to 20 mA DC output)<br>4-wire type: Approx. 3 W [100 Ω / 0°C (Pt100) output], Approx. 4 W (4 to 20 mA DC output)                                                                                                                                                         |
|                                                                                                                                                                                                                                                                                     | CO <sub>2</sub>                                                                                                                                           | Approx. 3 W                                                                                                                                                                                                                                                                                             |
| Element Type                                                                                                                                                                                                                                                                        | Temperature                                                                                                                                               | RTD 100 Ω / 0°C (Pt100) (IEC 60751)                                                                                                                                                                                                                                                                     |
|                                                                                                                                                                                                                                                                                     | Humidity                                                                                                                                                  | Electrostatic capacity variation type                                                                                                                                                                                                                                                                   |
| Measurement Method                                                                                                                                                                                                                                                                  | CO <sub>2</sub>                                                                                                                                           | Non-dispersive infrared (NDIR)                                                                                                                                                                                                                                                                          |
| Performance                                                                                                                                                                                                                                                                         | Accuracy                                                                                                                                                  |                                                                                                                                                                                                                                                                                                         |
|                                                                                                                                                                                                                                                                                     | Temperature                                                                                                                                               | 100 Ω / 0°C (Pt100) output: ± (0.1 + 0.0017 t )°C<br>4 to 20 mA DC output: ± 0.5°C<br>Under the conditions of:<br>Input power supply: 24 V, Load resistance: 250 Ω,<br>Wind velocity: 0.15 m/s, Warm-up period: 60 minutes<br>The output accuracy will be affected if the conditions above are changed. |
| Performance                                                                                                                                                                                                                                                                         | Humidity                                                                                                                                                  | ± 5 %RH (at 5 to 45°C), Outside of 5 to 45°C: Max. ± 8 %RH<br>Under the conditions of:<br>Input power supply: 24 V, Load resistance: 250 Ω,<br>Wind velocity: 0.15 m/s, Warm-up period: 60 minutes<br>The output accuracy will be affected if the conditions above are changed.                         |
|                                                                                                                                                                                                                                                                                     | Response Characteristics                                                                                                                                  |                                                                                                                                                                                                                                                                                                         |
|                                                                                                                                                                                                                                                                                     | 63% response within 1 minute (at 1.5 m/s wind velocity)                                                                                                   |                                                                                                                                                                                                                                                                                                         |
|                                                                                                                                                                                                                                                                                     | Approx. 20 sec [Time to reach 90% of the RH value when the RH shifts between 30%↔85%RH. However, airflow 5 l/min (0.16 m/s)] (Waterproof filter attached) |                                                                                                                                                                                                                                                                                                         |


|                       |                                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                    |
|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
|                       | CO <sub>2</sub>                                                                                                                                                                                                                                                    | ±(50 ppm + 3% of measured value).<br>Warm-up period: 30 minutes<br>Note: Accuracy described here is the factory default.                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Within 120 seconds |
| Sensor Correction     | CO <sub>2</sub>                                                                                                                                                                                                                                                    | One cycle is equivalent to 45 days, and if the measured value drops below 400 ppm in the current cycle, the lowest value in the current cycle will become 400 ppm in the next cycle, and the difference between the lowest value and 400 ppm will be added to all other measured values in the next cycle.                                                                                                                                                                                                                                                                                   |                    |
| Dimensions            | W90 x H90 x D32 mm (excluding lead wire)                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                    |
| Weight                | Temperature, Humidity                                                                                                                                                                                                                                              | Approx. 90 g                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                    |
|                       | CO <sub>2</sub>                                                                                                                                                                                                                                                    | Approx. 100 g                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |                    |
| Mounting              | To the outlet box (inside wall), via outlet box cover: Mounting dimension: 66.7 mm (JIS C8340: 1999) (JIS: Japan Industrial Standards)                                                                                                                             |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                    |
| Operating Environment | Temperature                                                                                                                                                                                                                                                        | Temperature: 0 to 50°C, Humidity: 5 to 95 %RH (non-condensing)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                    |
|                       | Humidity                                                                                                                                                                                                                                                           | Temperature: 0 to 50°C, Humidity: 5 to 90 %RH (non-condensing)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                    |
|                       | CO <sub>2</sub>                                                                                                                                                                                                                                                    | Temperature: 0 to 50°C, Humidity: 0 to 95 %RH (non-condensing)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                    |
|                       | <b>[Caution]</b> Do not use this sensor in an environment where dew condensation occurs.<br>Do not use this sensor in an environment where chlorinated and sulfidizing gases are being generated, otherwise the thin film of the humidity sensor will deteriorate. |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                    |
| Storage Environment   | Temperature                                                                                                                                                                                                                                                        | Temperature: -20 to 60°C, Humidity: 5 to 95 %RH (non-condensing)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                    |
|                       | Humidity                                                                                                                                                                                                                                                           | Temperature: -20 to 60°C, Humidity: 5 to 90 %RH (non-condensing)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                    |
|                       | CO <sub>2</sub>                                                                                                                                                                                                                                                    | Temperature: -30 to 70°C, Humidity: 0 to 95 %RH (non-condensing)<br><b>[Caution]</b> Do not apply sustained pressure or shock to the cavity (gold-colored section) when handling (installing or storing) the sensor. If the sensor is exposed to a temperature lower than 0°C or higher than (and including) 40°C for several hours, sensor measurement value will be affected.<br>If the sensor is stored at high humidity (90% or more) over a long period without power supplied, the initial measurement value may become slightly high until the humidity inside the cavity disappears. |                    |
| Accessories           | Sensor main unit mounting screw: M3 x 4 (4 pieces), Mounting plate, Mounting plate screw: M4 x 8 (2 pieces), Spring washer (2 pieces), Instruction manual: 1 copy                                                                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |                    |

## ■ Wiring


Lead wire: 300 mm, Cross-section area: 0.5 mm<sup>2</sup>

Lead wire color: White (WHT), Red (RED), Black (BLK), Brown (BRW), Yellow (YLW), Orange (ORG)


DSW-100-TR

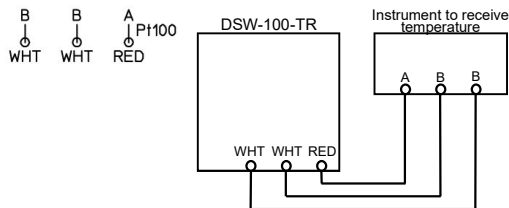


DSW-100-TA

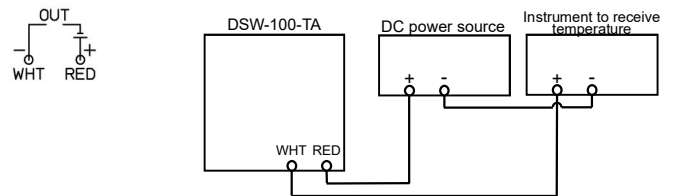


DSW-100-TA W4

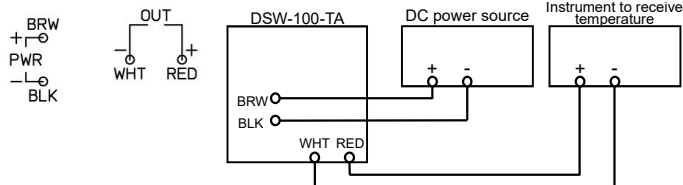


DSW-100-H

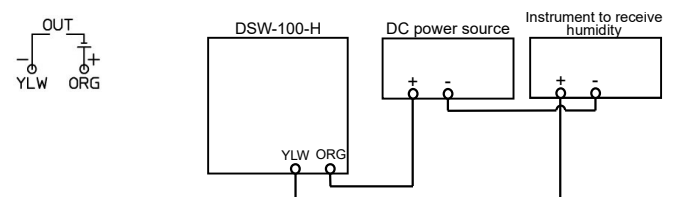


DSW-100-H W4, DSW-100-HV W4

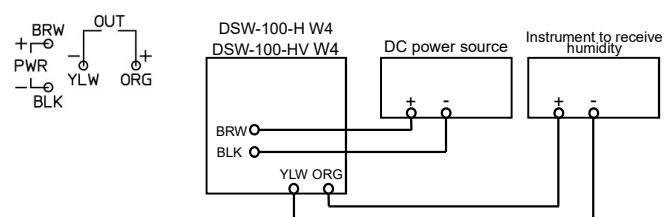


DSW-100-TRHV W4

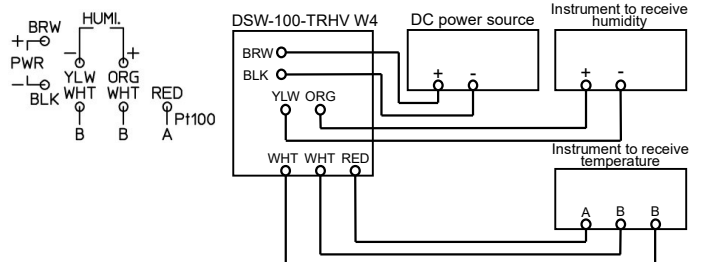


## DSW-100-TAH

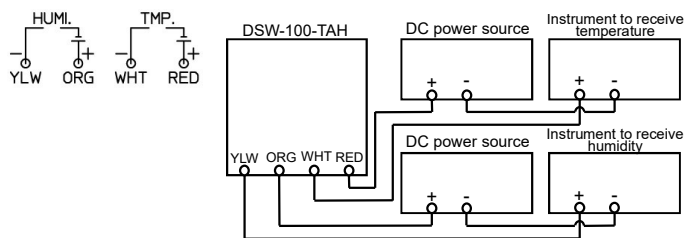


## DSW-100-TAH W4, DSW-100-TAHV W4

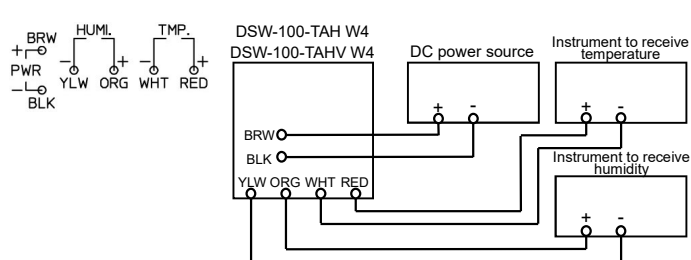


## DSW-200-CO2

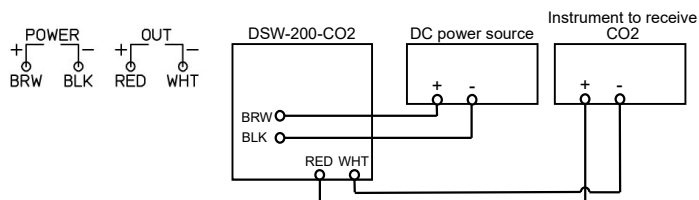

## ■ Dimensions (Scale: mm)

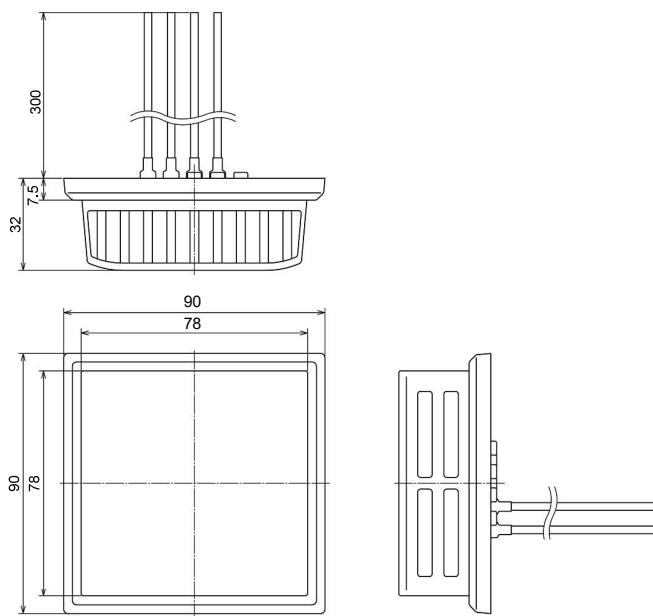

Mounting Plate

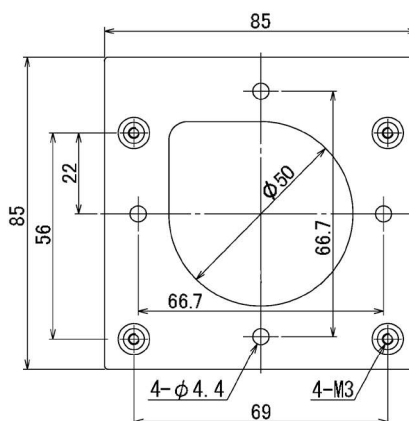

### SAFETY PRECAUTIONS

- To ensure safe and correct use, thoroughly read and understand the manual before using this instrument
- This instrument is intended to be used for industrial machinery, machine tools and measuring equipment. Verify correct usage after purpose-of-use consultation with our agency or main office.  
(Never use this instrument for medical purposes with which human lives are involved.)
- External protection devices such as protection equipment against excessive temperature rise, etc. must be installed, as malfunction of this product could result in serious damage to the system or injury to personnel. Also proper periodic maintenance is required.
- This instrument must be used under the conditions and environment described in the manual. Shinko Technos Co., Ltd. does not accept liability for any injury, loss of life or damage occurring due to the instrument being used under conditions not otherwise stated in this manual.

### Caution with respect to Export Trade Control Ordinance

To avoid this instrument from being used as a component in, or as being utilized in the manufacture of weapons of mass destruction (i.e. military applications, military equipment, etc.), please investigate the end users and the final use of this instrument. In the case of resale, ensure that this instrument is not illegally exported.

- This catalog is as of July 2022, and specifications are subject to change without notice.
- The photos in this catalog do not show actual usage.
- If you have any inquiries, please consult us or our agency.

## SHINKO TECHNOS CO., LTD. OVERSEAS DIVISION

Head Office : 2-5-1, Senbahigashi, Minoo, Osaka, 562-0035, Japan  
Tel : +81-72-727-6100  
Fax : +81-72-727-7006  
URL : <https://shinko-technos.co.jp/e/>  
E-mail : [overseas@shinko-technos.co.jp](mailto:overseas@shinko-technos.co.jp)